

## PRODUCT SERVICE BULLETIN

This document is controlled electronically. Printed copies of this document are not controlled.  
Document users are responsible for ensuring printed copies are the latest revision prior to use.

### **FIX AS FAIL: B/BX-Series; Oil Leakage From Loader Quick Coupler**

Repairs described in this bulletin may be made only in the event of a failure.

**R1 Revision:** Added B2601HSD-1 to the affected units.

**R2 Revision:** Added serial number range for B2401DT.

**R3 Revision:** Updated affected serials for the BX23S Models.

**Product Line:** B/BX-Series

**Model:** BX1880, BX2380, BX2680, BX23S, B2301HSD-1, B2601HSD-1, B2401DT, BX2417, B1677, B1982

#### **Serial Numbers Affected:**

Model	Serial Numbers	Model	Serial Numbers	Model	Serial Numbers
BX1880	10001 to 21997	BX23SLSB-R BX23SLB-R	10005 to 49519	B2401DT	10001 to 11921
BX2380	10001 to 45247	BX23SLSB-T BX23SLB-T	All	B2601HSD-1	63307 TO 75329
BX2680	10001 to 24150	BX23SLB-R14-1 BX23SLSB-R-1	60001-60004	B2301HSD-1	57194 TO 62330


#### **Wholegood Kits Affected (To be filed under the tractor they are installed on):**

Model	Model	Model
BX2417 VALVE-KIT 2380	B1982 LOADER VALVE KIT	B1677 HYDRAULIC PIPE KIT

#### **Issue:**

Loader Quick Coupler leakage has been noted after the tractor has been sitting for a day or more under low oil pressure.

The wholegoods kits affected are not serialized; this issue only applies to wholegood kits containing the old-style couplers. Please see the below image for examples of the old-style vs. new-style to determine if this bulletin applies.

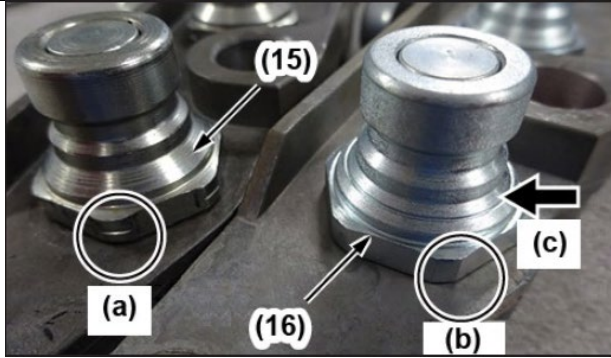

(15) Old Cartridge  
(16) New Cartridge

(a) Notch in Hex.  
(b) No Notch in Hex.  
(c) Groove on surface

Confidential and Proprietary