

Service Bulletins

Keywords to search for existing questions/answers or enter a ref #

3599922040

Search

View by series / model Note: Can be sorted by "year" or "failure code" by clicking on the arrows

AG Only - View by create date in descending order (easier for sequential printing) Note: Can be sorted by "Series" by clicking on the arrow


CE Only - View by create date in descending order (easier for sequential printing) Note: Can be sorted by "Series" by clicking on the arrow

A **Technical Service Bulletin** is a formal advisory to dealers on Kubota approved recommended repairs, update to repair techniques or troubleshooting strategies. It can also be used to inform dealerships about improved parts, service manual updates and Mandatory Field Campaigns. The ultimate purpose of "Technical Service Bulletins" is to improve the reliability and or the performance of the equipment.

SERVICE BULLETIN

No: **AG016 - 15**
 Series: **M-series**
 Fail Code: **ST02**
 Date: **03/19/2015**
 Issued by: **Edward Lambert**
 General Manager, Service & Engineering

Subject:	Heat Resistant O-Ring for Steering Controller	
Model(s):	M95X, M105X, M125X, M108X, M100X, M110X, M126X, M135X	
Serial Ranges:	M95X, M105X, M125X, M108X, M100X, M110X, M126X, M135X	ALL/TOUS

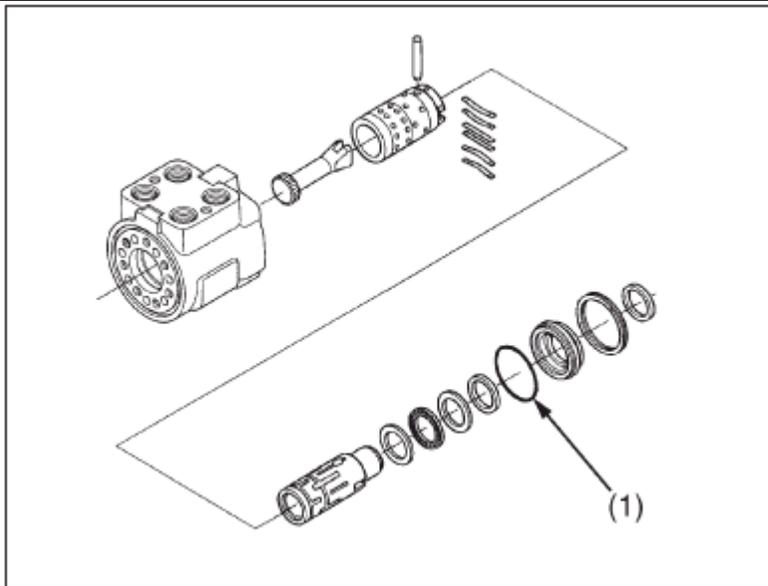

Service Information:

Kubota has found that sometimes oil leakage can occur at the steering controller due to thermal deformation of the o-ring. If an oil leak has occurred at the steering controller due to thermal deformation of the o-ring, Kubota has available a more heat resistant o-ring which should be installed when repairing

Parts Information:

Original Part Numbers - **DO NOT ORDER**

No.	PARTS NAME	PARTS NO.	Q'ty
1	O-RING	3599922040	1
1	Seal Kit	3C01197050	1

New Part Numbers (Heat Resistant)

No.	PARTS NAME	PARTS NO.	Q'ty
1	O-RING	3T40397040	1
1	Seal Kit	3T40397050	1

The 3T40397050 SEAL, KIT includes the 3T403907040 O-RING and 3C01197050 SEAL, KIT.

Warranty Information:

Labor Allowances	TMBb-025: 1.7hr
Parts	Refer to Parts Information section above.
Service Bulletin	AG016-15
Warranty Terms	Normal Warrant Applies
Wash Code	TMMN-011: 0.8hrs
Key part number	3599922040 or 3C01197050

Additional Information:

FI-A-15-001